

MAY 19 2026

Karen Brown

MURRAY COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


Northeast Corner of Section **2**, Township **108**, Range **43**
Fifth Principal Meridian, State of Minnesota, County of **Murray**

At the corner location shown on the sketch:

☒ On October 25, 2025 found Nothing
DATE

☐ left monument as found ☐ lowered monument ☐ removed monument (explain)

☒ On Dec. 9, 2025 placed a 5/8" rebar with a plastic cap stamped "46169"
DATE

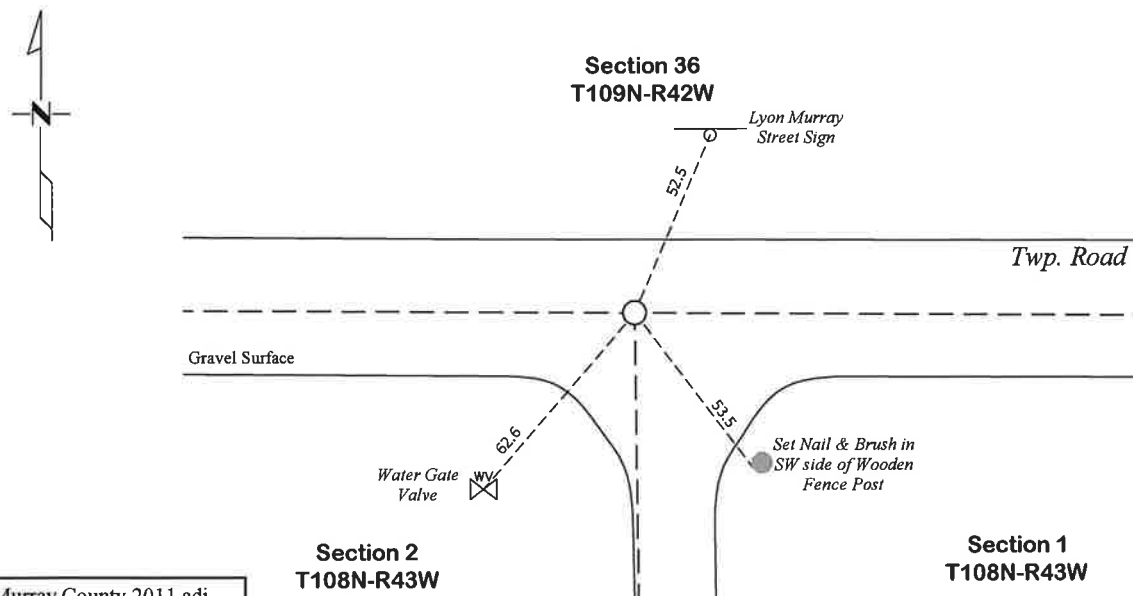

Murray County 2011 adj.
N: 227055.56
E: 448390.59

Statement of evidence for this corner location is on back of this page.

I hereby certify that this survey, plan, or report was prepared by me or under my direct supervision and that I am a duly Licensed Land Surveyor under the laws of the state of Minnesota.

Signature

Joshua M. Stern, Minnesota Registered Land Surveyor #46169

Date

5/13/26

STATEMENT OF EVIDENCE

Northeast Corner Section 2, T108N-R43W

- 1866** JW Bishop was contracted by the United States Government Land Office to perform the Original Public Land Survey in this township. Bishop records in his field notes that he “set post in mound for closing Cor”.
- 1899** Murray County Survey Record Book for Section 1, T108N-R43W, notes “Gov. stake mound and pits” at corner position but does not dimension to any neighboring corners.
- Unknown** Murray County Section Corner tie records show “Marked Field Stone”, note two concrete blocks used for ties, and dimension to neighboring corners.
- 1984** Lyon County Highway Plans make no mention of this corner and show the area as a large cut for construction.
- October 2025** Bonnema Runke Stern field crews searched the area with a metal locator but found no surface monumentation at the corner position. Field crews also searched for concrete block ties and were unsuccessful. With no other available evidence, a 5/8” x 15” rebar with a plastic cap was placed on a straight line between the SE & S¼ corners of Section 36 at the distance from the SE corner of Section 36, as shown on the Murray County section corner tie records. No large excavation was done for this corner position as the 1984 Highway Plans show this area of the road in a cut section, that cut would have destroyed any corner evidence and therefore the corner was not excavated.