


Index No. KL-9

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NUMBER 15 MEANDER Corner of Section 17 ,Township 108 N ,Range 41 W  
5th Principal Meridian, State of Minnesota, County of MURRAY

At the corner location shown on the sketch:

- On \_\_\_\_\_ found a \_\_\_\_\_  
DATE
- left monument as found,       lowered monument,       removed monument (explain)
- On 12/17/03 Placed a COMPUTED A LOST POSITION FOR CORNER  
DATE

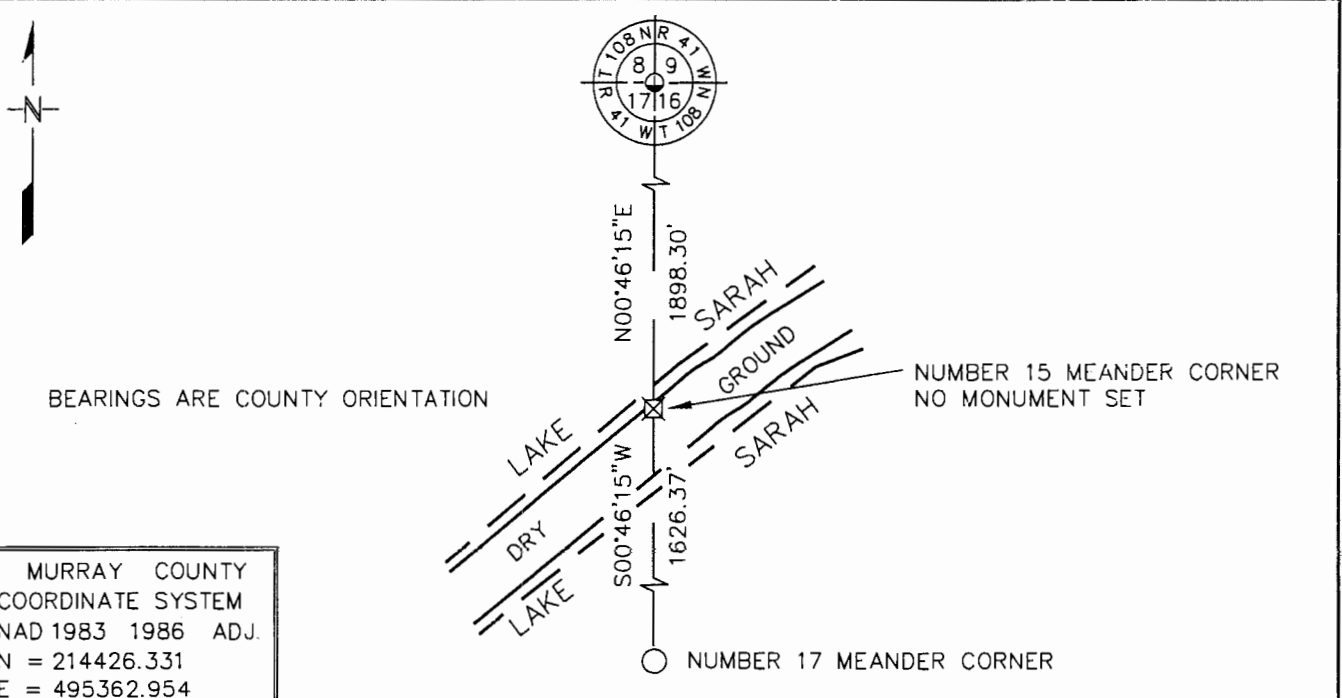

Statement of evidence for this corner location is on back of this page.

JUNE 2004  
WAS00473.00.00.01

I certify that this document was researched and prepared by me or under my direct supervision.

SIGNATURE Bruce W. Sheppard DATE 6-29-04 License Number 17003

Title:  Land Surveyor     Professional Engineer     County Surveyor     County Engineer

Meander Corner Number 15 of Section 17, Township 108 North, Range 41 West

The DNR Division of Lands and Minerals contacted the following for survey information:

Minnesota Secretary of State's Office  
Murray County Recorder's Office  
Murray County Highway Engineer's Office  
Zieske Land Surveying, Inc. of Windom  
B & G Land Surveys, Inc. of Redwood Falls  
Moseng Land Surveying of Marshall  
Madsen Land Surveying, Inc. of Fairmont

1854 U.S. General Land Office notes, obtained from the Secretary of State's Office, show the corner marked with a post with the following bearing trees marked:

10" White Ash, South 26° West, 54 links (35.64 feet)

12" Elm, North 89° East, 18 links (11.88 feet)

The corner is shown:

51.24 chains (3381.84 feet) North of the southeast corner of Section 17

1967 August 18, the DNR Survey Unit established the east line of Section 17 as a straight line from the southeast corner of Section 17 to the northeast corner of Section 17. No information is given about this meander corner. Monuments were set along the east line of Section 17 at the following distances north of the southeast corner of Section 17:

463.98 feet

1729.41 feet

2003 January, a Certificate of Survey in Government Lot 2 of Section 17, obtained from Zieske Land Surveying, Inc., and signed by Perry L. Zieske, LS 23008, shows monuments along the east line of Government Lot 2 but no information is given about this meander corner. The monuments are shown as follows:

A) found monument 439.92 feet north of the southeast corner of Section 17

B) set monument 992.29 feet north of the southeast corner of Section 17

C) found monument 1729.22 feet north of the southeast corner of Section 17

2003 December 17, the DNR Division of Lands and Minerals computed the lost position for corner and found it to be:

3382.10 feet from the southeast corner of Section 17

1898.30 feet from the northeast corner of Section 17

Searched for but found no evidence of the GLO bearing trees to corner.

Also, searched for and found monuments per the 1967 DNR survey and the 2003 survey by Perry L. Zieske and found them to be:

from 0.15 of a foot west to 2.01 feet east of a straight line between the southeast and the northeast corners of Section 17

Accept the computed lost position as the location of the corner, however a monument was NOT set to mark its location.