

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


3 MEANDER Corner of Section 24, Township 107 N., Range 39 W., 5th. P.M.

STATE OF MINNESOTA, County of MURRAY

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 9-17-85 placed a 1 1/4" x 1 1/4" x 20" PERFORATED STEEL TUBE WITH
DATE
ALUMINUM CAP STAMPED "D.N.R. SURVEY MARKER", UP 0.2'

SKETCH OF REFERENCE TIES

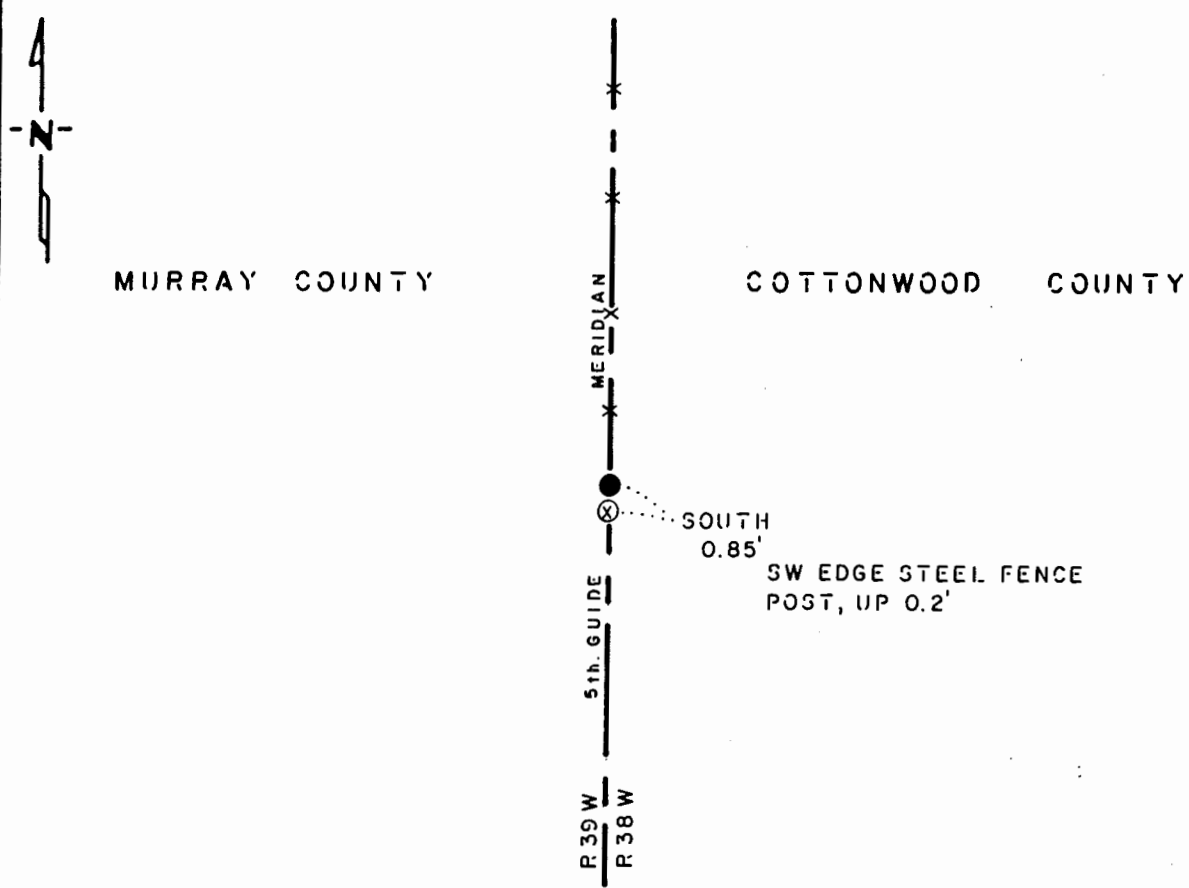

BEARINGS OBSERVED WITH COMPASS

Statement of evidence relative to this corner location is on back of page.

J. B. M. 10-30-85
G-1181

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Lowell R. Pomeroy 11-7-85
SIGNATURE DATE

Registration No. 17005

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the Co. Recorders office at _____ .M. on the _____ day of _____ A.D., 19 _____

County Recorder _____

By: _____, Deputy

DOCUMENT NO. _____

Meander Corner #3, Section 24, Township 107 North, Range 39 West

This corner was originally established by the U. S. General Land Office survey in 1857. The government notes show corner marked with a wood post set in mound of earth with pits and trench dug around the mound. Also deposited charcoal and planted plum seeds northeast and southwest.

In March 1985, the DNR Bureau of Engineering contacted the following for corner information:

Murray County Offices of the Recorder and Highway Engineer
Cottonwood County Offices of the Recorder and Highway Engineer
Mn/Dot Office in St. Paul
U.S. Dept. of the Interior, Fish and Wildlife Office in Minneapolis
Land Surveying Firms:
Martin Land Surveying of Worthington
Madsen Land Surveyors of Fairmont
Sioux Engineering of Windom

The following information was obtained from Sioux Engineering:

A copy of a resurvey plat of Township 107 North, Range 38 West, obtained from Howard Boeck of Westbrook, and done by C. W. Gove, County Surveyor, in 1898, shows this corner:

691 ft. from the east quarter corner Section 24
Survey does not show what was found or set at corner.

The following information was obtained from the Cottonwood County Recorders Office:

Surveyor's Record Book A, on page 196, contain a survey by C. W. Gove, County Surveyor, dated June 29, 1898. Survey shows the corner to be an oak stake 691 ft. from the east quarter corner of Section 24

In March 1985, the DNR Bureau of Engineering traversed to the area of the corner and searched for but found no evidence of the corner. Computed a lost position using the northeast corner of Section 36 and the east quarter corner Section 24. Lost position measured:

7228.61 ft. from the northeast corner Section 36
675.83 ft. from the east quarter corner Section 24

Searched at the lost position and found it to be on a vague lank bank \pm 100 ft. north of marsh area, on a north-south fence. No evidence of the corner was found, fence approximately 75 years old.

Accept the lost position as the location for the corner.

Traverse information is available from the DNR Bureau of Engineering.

sln34/cors