

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTH QUARTER Corner of Section 28, Township 106 N., Range 42 W., 5th P.M.

STATE OF MINNESOTA, County of MURRAY


At the corner location shown on the sketch:

- On 11-3-83 found a 7"x8"x10" FIELD STONE, DOWN 36" WITH WOOD HUBS
DATE
BESIDE IT
- left monument as found, lowered monument, removed monument (explain)
- On 11-3-83 placed a 1 1/4" x 1 1/4" x 20" PERFORATED STEEL TUBE WITH
DATE
ALUMINUM CAP STAMPED "D.N.R. SURVEY MARKER" OVER STONE, DOWN 0.4'

SKETCH OF REFERENCE TIES

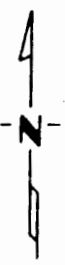

NOTE:
MONUMENT IS
2' SOUTH OF ϵ E-W ROAD
ON FENCE TO SOUTH

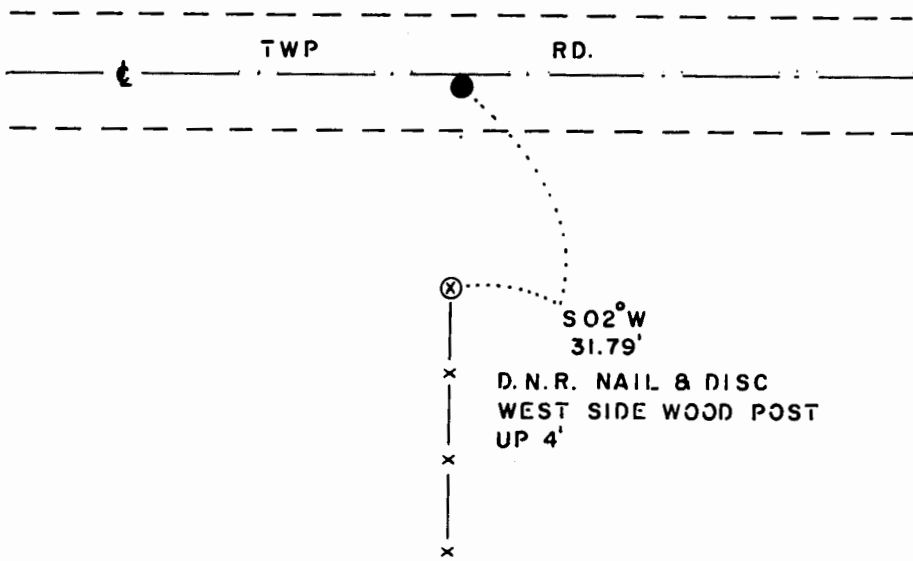

BEARINGS OBSERVED WITH COMPASS

Statement of evidence relative to this corner location is on back of page.

J. B. M. 4-2-84
G-1158

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Lowell R. Powers 6-16-86
SIGNATURE DATE

Registration No. 17005

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER
County of _____

I hereby certify that this document was filed in the Co. Recorders office at _____ .M. on the _____ day of _____ A.D., 19 _____

County Recorder _____
By _____, Deputy

DOCUMENT NO. _____

North Quarter Corner Section 28, Township 106 North, Range 42 West

This corner was originally established by the U. S. General Land Office survey in 1866. The government notes show corner marked with a wood post set in mound of earth with pits and trench dug around the mound.

In November 1983, the DNR Bureau of Engineering contacted the Murray County Offices of the Recorder and Highway Engineer for corner information.

The following information was obtained from the County Recorder's Office: Surveyor's Record Book A, on Page 229 contains a survey by J. W. Woolstencraft, dated November 20, 1912. Survey shows corner as a stone in road, being:

1322 ft. from the south sixteenth corner southwest quarter
Section 21, a stone in road

2644 ft. from the northwest corner Section 28

This information is also contained in a Surveyor's Record Book in the Highway Engineer's Office.

On November 3, 1983, the DNR Bureau of Engineering hired a backhoe operated by Johnson Tiling of Lake Wilson to dig for evidence of this corner. Encountered old road bed down 21", natural ground down 32", and found a 7" by 8" by 10" field stone down 36" with wood hubs beside it. Left everything as found and set a bridge spike on the north side of stone. Stone measures:

2643.34 ft. from the northwest corner Section 28

1321.67 ft. east of a fence line north.

Accept the found stone as the location of the corner.

Traverse information is available from the DNR Bureau of Engineering.

6hab/cors