

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner Corner of Section 25, Township 107, Range 40, 5TH P.M.

STATE OF MINNESOTA, County of Murray


At the corner location shown on the sketch:

On 7/10/2025 found a 2"x36" pipe down 2.5± below the road surface.

left monument as found,  lowered monument,  removed monument (explain)

On 11/7/2025 placed a 5/8" iron with seal 43844 over pipe. (see statement of evidence)

SKETCH OF REFERENCE TIES

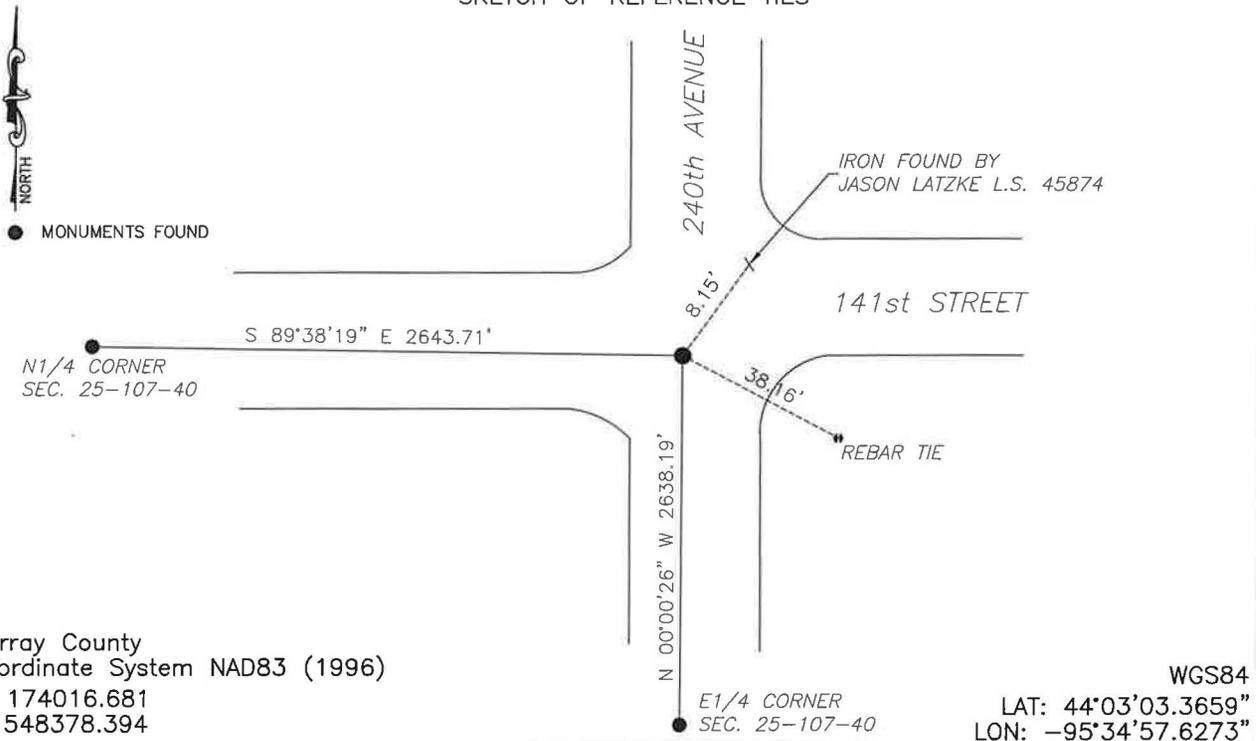

Murray County  
Coordinate System NAD83 (1996)  
N: 174016.681  
E: 548378.394

WGS84  
LAT: 44°03'03.3659"  
LON: -95°34'57.6273"

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

*Daniel L. Buettel* 1/16/2026  
DATE  
Daniel L. Buettel  
License No. 43844

**MURRAY COUNTY RECORDER**

*Karen Brown*

JAN 20 2026

## Statement of Evidence

Northeast Corner Section 25, T107N, R40W of the 5th P.M.

In 1861 J.W. Myers surveyed the original township lines.

September 1861, L. Brockmann did the original township subdivision.

In October 1898 survey records show a government stake and 6"x6"x18" stone at the corner.

In September 2020 Westwood Professional Services found a No.5 rebar of unknown origin. Excavated 8x8x3.5' hole under rebar and found nothing. Accepted position of found rebar.

On July 10, 2025 Bueltel-Moseng Land Surveying found a 2"x36" pipe down 2.5'± below the road surface, the position of the pipe is 6'± south and 2.5'± west of the intersection of the north-south road and the road going west and is 15'± south of the centerline the road going east. Found pipe is S 13°12'23" W from found iron with cap LS 45874.

November 7, 2025, Dug with backhoe next 2" pipe and found nothing further. Top of pipe is at level of natural clay. Determined road has been lowered and pipe was put in place of stone. Accepting position of 2" pipe.  
Set 5/8" iron with seal 43844 over 2" pipe.