

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


EAST QUARTER Corner of Section 21, Township 108 N., Range 40 W., 5th P.M.

STATE OF MINNESOTA, County of MURRAY

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 7-1-85 placed a 1 1/4" x 1 1/4" x 20" PERFORATED STEEL TUBE WITH
DATE
ALUMINUM CAP STAMPED "D.N.R. SURVEY MARKER", UP 0.3'

SKETCH OF REFERENCE TIES

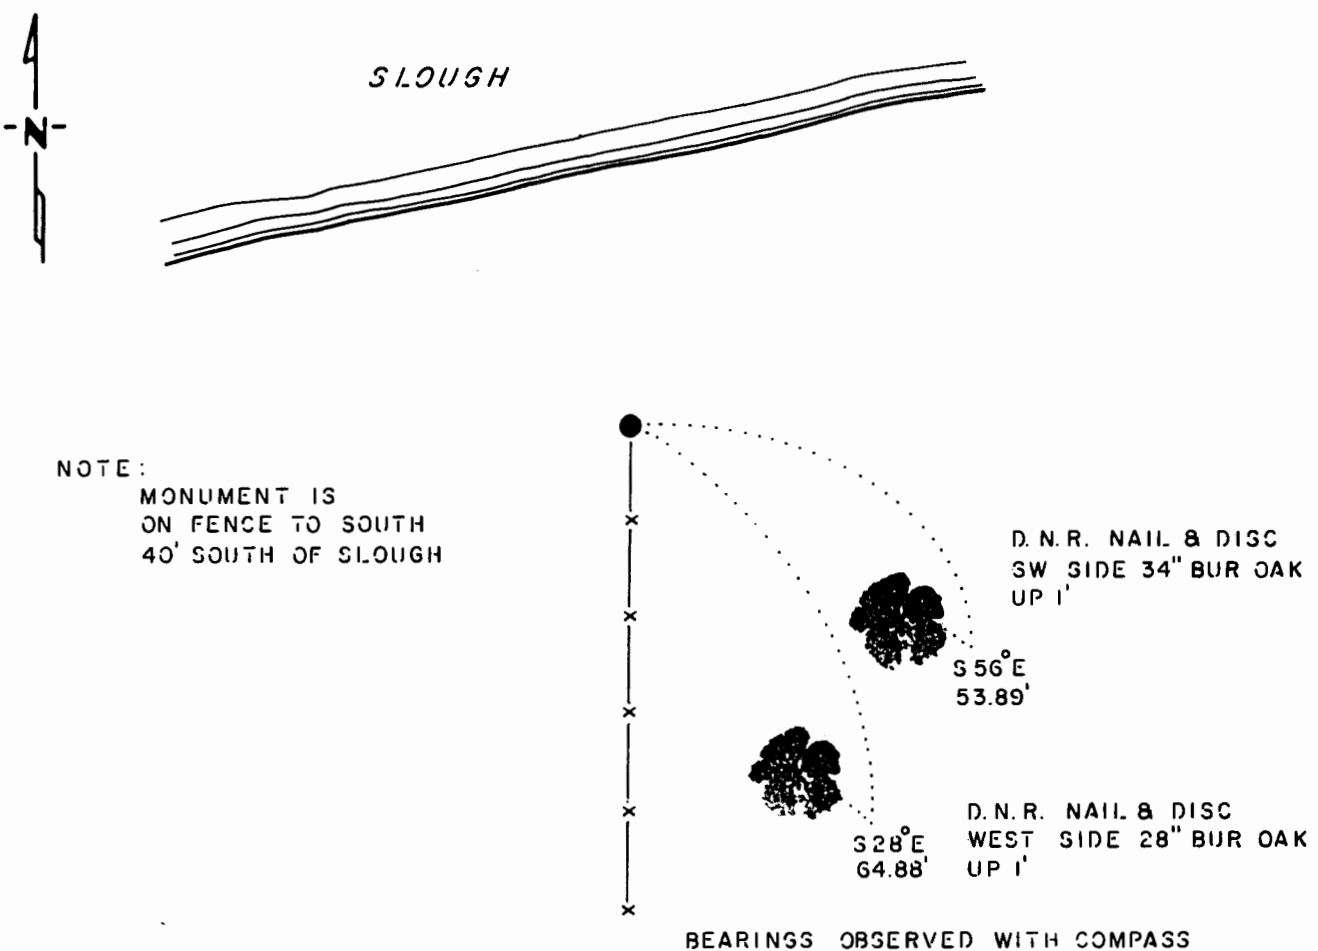

Statement of evidence relative to this corner location is on back of page.

J. B. M. 7-10-85
G-361

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Lowell R. Pomeroy Jr. 7-22-85
SIGNATURE DATE
Registration No. 170051
 Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER **172140**
County of Murray

I hereby certify that this document was filed in the Co. Recorders office at 10 .M. on the 30th day of July A.D., 19 85

County Recorder Harry J. Chae
By [Signature], Deputy
DOCUMENT NO. 172140

East Quarter Corner Section 21, Township 108 North, Range 40 West

This corner was originally established by the U. S. General Land Office in 1861. The government notes show corner marked with a wood post with the following bearing tree marked:

28" Bur Oak, South 49 1/2° East, 83 links (54.78 ft.)

In October 1984, the DNR Bureau of Engineering contacted the Murray County Offices of the Recorder and Highway Engineer for corner information.

No resurvey information was obtained on this corner.

In October 1984, the DNR Bureau of Engineering traversed to the area of the corner and located the north end of a north-south fence. Found a 34 inch diameter bur oak with blazes 18 inches high by 6 inches across on the northwest and southwest sides. Blazes were covered with bark, so removed bark but found no evidence of scribing or hack marks. Established a temporary position for this corner at the north end of the north-south fence. The temporary position was found to be 54.78 feet from the center of the 34 inch bur oak and 12.76 feet north and 0.02 of a foot west of a lost position between the northeast corner of Section 21 and the northeast corner of Section 33.

Accept the temporary position as the location of the corner.

Traverse information is available from the DNR Bureau of Engineering.

recl6/missu2